FCO 512-00386A: Anti-noise Foams Kit For ThermoFlex Mid II Platesetter

Document number: 719-00733B-EN Rev B

Applies to	Kodak® ThermoFlex® Mid II	**Priority:** Next failure
Component	Side doors and rear panel	

Problem

The ThermoFlex Mid II platesetter generates noise during normal operation.

Solution

Attach noise-absorbing foam units to the side doors and rear panels.

Time required	2 hours
Prerequisite FCOs	N/A

Parts included in FCO

Part Number	Part Name	Quantity	
252-12611A	Upper foam right door	1	
252-12612A	Upper thin foam right door	1	
252-12613A	Lower foam right door	1	
252-12614A	Lower thin foam right door	1	

252-12615A	Foam left door	1	
252-12616A	Thin foam left door	1	
252-12617A	Foam rear panel	1	
252-12618A	Thin foam rear panel *Note: The two unidentical pieces form one unit.	1*	
719-00733B	FCO document for FCO 512-00386A: Anti-noise Foams Kit For ThermoFlex Mid II Platesetter	1	
651-00622A	FCO tracker diskette	1	


FRU after FCO implementation	N/A
Tools required	N/A

Procedure

1. In the ThermoFlex Controller software, open the loading table.
2. From the front of the platesetter, access the side doors:
   a. Slide open the loading tray.
   b. Open the front panel.
   c. Open the side doors.
3. On the right side door, attach the black upper foam unit (252-12612A) and thin black lower foam unit (252-12614A) to the door, and then attach the silver upper foam unit (252-12611A) and silver lower foam unit (252-12613A) to the black foam units, as shown.



Right side door without foam attached

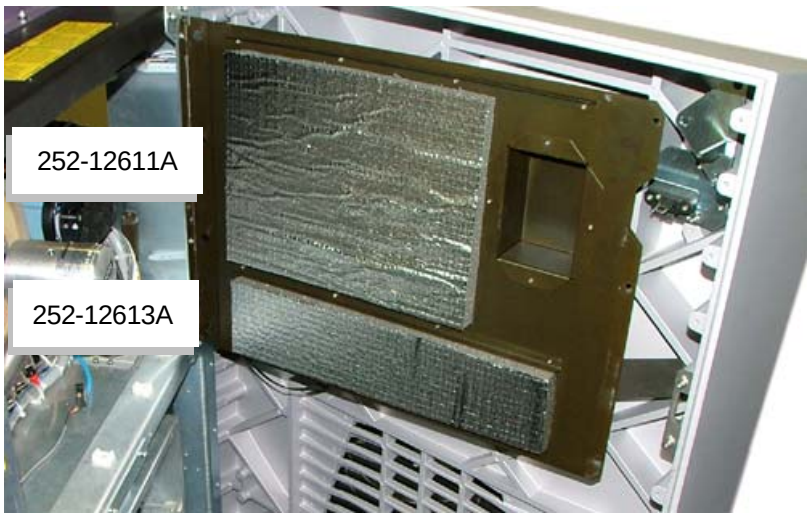


Right side door with foam units attached. The black foam units (252-12612A and 252-12614A) are underneath the silver foam units (252-12611A and 252-12613A).

4. On the left side door, attach the thin black foam unit (252-12616A) to the door, and then attach the silver foam unit (252-12615A) to the black foam unit, as shown.



Left side door without foam attached

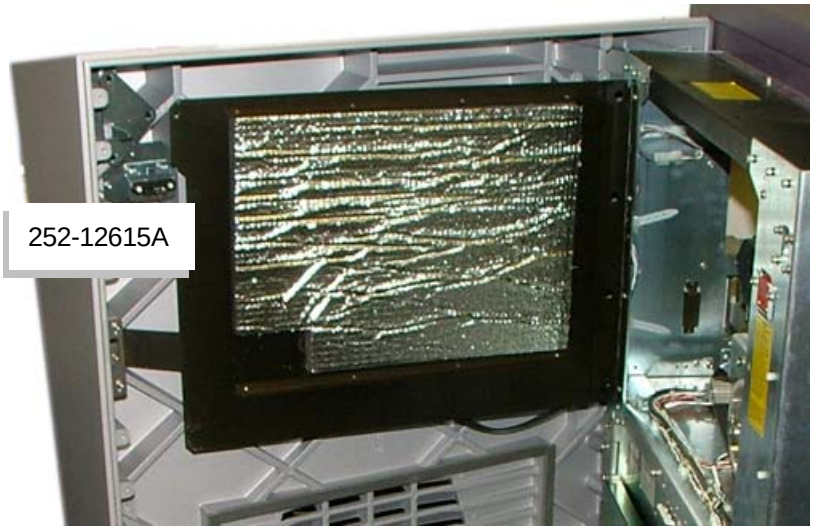

Left side door with foam units attached. The black foam unit (252-12616) is underneath the silver foam unit 252-12615A.

5. Open the service door.
6. Remove the upper rear panel.
7. On the upper rear panel, attach the two pieces of the thin black foam unit (252-12618A) to the panel, and then attach the silver foam unit (252-12617A) to the black foam unit, as shown.



Rear panel without foam units attached



Rear panel with foam units attached. The two-piece black unit (252-12618A) is underneath the silver foam unit (252-12617A).

8. Reinstall the upper rear panel.
9. Close all doors and panels.
10. Connect the power to the platesetter.
11. Turn on the platesetter and start ThermoFlex Controller. Verify that the platesetter status is **Ready**, and that no open interlock messages appear.

Install FCO Tracker	Insert the diskette and double-click the .**exe** file, or download the file from the FCO page. For more information, see the FAQ: FCO Tracker.
Upon completion	N/A
Material disposition	None
See also	N/A
Technical contact	Viki Arviv
Date submitted	01 Nov 2006
Last updated	24 Dec 2006