FCO 512-00182A

Improving the single-loading cassette's plate/paper separation

Document number: 719-00393A Rev A

Release date: 10 Feb 2005

Applies to

- Lotem® 800
- Lotem 800 II
- Lotem 800 Quantum
- Lotem Quantum Spectrum

Priority: Next visit


Component Single-loading cassette (SLC) system

Problem

- Static electricity and/or a slip sheet that sticks to a plate may cause double feeding; meaning the plate and the slip sheet (immediately beneath the plate) are loaded together.
- During the plate loading process, the slip sheet does not separate from the plate that is immediately beneath it.

Solution

Install the improved SLC centering arms with the paper/plate separation brackets, supplied in this FCO kit. When *Step A* of the loading process is performed - *Loading plate from cassette entry to punch entry*, the improved centering arms and brackets cause the plate to bend in a convex shape. The convex bending forcibly separates the plate from any slip sheets that are immediately above and beneath the plate:

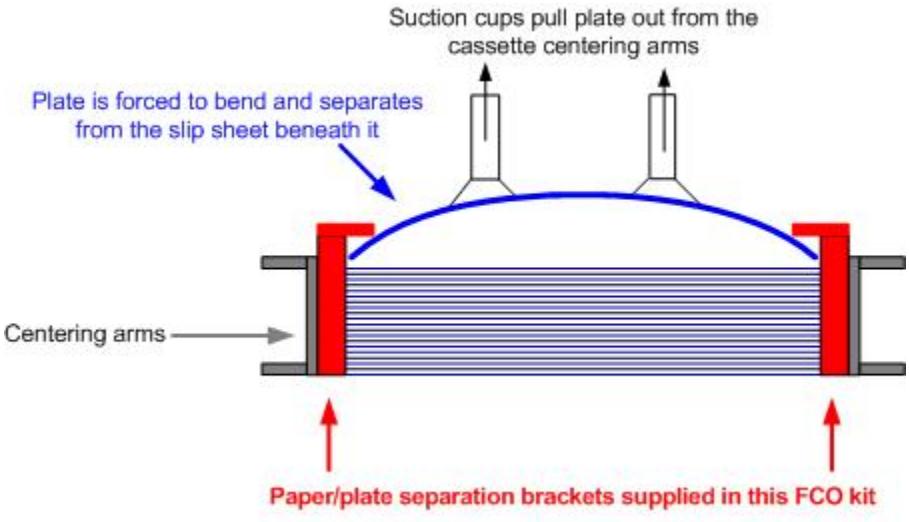

FCO 512-00182A

Time required Approximately 20 minutes

Parts included in FCO

Part Number	Part Name	Quantity
293A9B140A	Adjustable centering arm assembly	2
374A00080	Packing label - white	1
391S9B076	3.5" multi purpose single pack	1
651-00219B	Plate separation SLC diskette	1
719-00393A	Plate separt LTM800 DLC/SCU/MCU - IL05486	1


FRU after FCO implementation

Procedure


Before beginning this procedure:

- Check that the site's humidity falls within the required humidity range, which is approximately 55% +/- 5%.
- Check that the platesetter and the SLC are vertically aligned to each other.

1. In Lotem Controller, remove the cassette.
2. Open the SLC's cassette cover.
3. Remove all the plates from the cassette.
4. Remove the two existing centering arms and put the screws to one side:

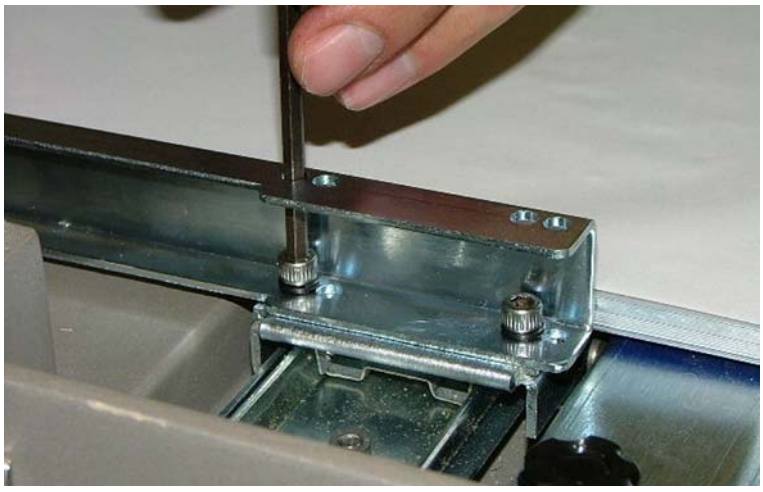

5. Use the screws from the previous centering arms to install the two improved centering arms (part number 293A9B140A). Make sure that the arms' separator pins are facing inwards, towards each other:

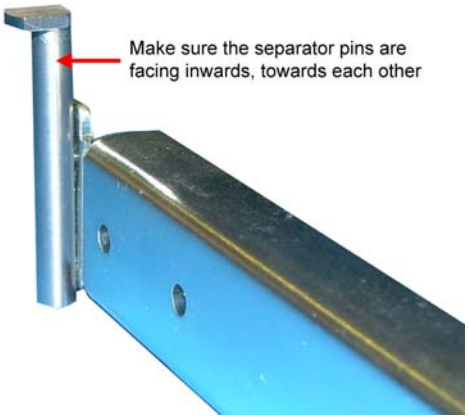

6. Manually open and close the centering arms. Make sure they are both moving smoothly.
7. Reload the plates into the cassette.
8. Use the centering arms to center the plates.
9. Lock the arms against the plates.
   Important: This FCO will only succeed if the arms are locked against the plates.
10. Close the SLC's cassette cover.
11. Reinsert the cassette into the platesetter.
12. Amend the following Lotem Controller parameters:
    Note: The parameters for each individual platesetter may vary slightly from those described in this table. The parameters in the table should be used for indicative purposes only.

Amend These Parameters	Value	
	Old	New
Y Motor\ ***Min Speed App ValueY plate high***	1	0
Loading system\load plate\from cassette to punch entry stage\ ***Y plate high up in cassette (Rel) speed***	1	0.7
Loading system\load plate\from cassette to punch entry stage\ ***Y plate high up in cassette (Rel)[mm]***	-45	-55
Loading system\load plate\from cassette to punch entry stage\ ***Y plate rell up in cassette (Rel)[mm]***	-16	-30
Loading system\load plate\from cassette to punch entry stage\ ***X Extra to short pins***	30	25
Loading system\load plate\from cassette to punch entry stage\ ***X Extra to short pins for 0.2***	28	23
Loading system\load plate\from cassette to punch entry stage\ ***Number of plate backward separations***	1	0
Loading system\ *X Prepare to catch plate [mm]*	365	373

FCO 512-00182A

Install FCO Tracker	Insert the diskette and double-click on the **exe** file, or download the file from TechPlanet's FCO page. For more information refer to the FAQ: FCO Tracker.

Logistics

Approved quantities:

CSC	Quantity
CEM	100
CAM	50
CJP	30
CAP	15
CSR	12

Schedule supplies for first lots:

	CSC				
	CEM	**CAM**	**CJP**	**CAP**	**CSR**
Schedule					
Jan 05	20	20	10	5	5
Feb	40	20	10	5	5
Mar	40	10	10	5	2

Inventory:

Lead time: 6 weeks.

Material disposition	Dispose of the old centering arms.
Technical contact	Moshe Arviv
Date submitted	22 Nov 2004
Last updated	03 Mar 2005