Procedure

Lotem 800 – Ver 3.20.01 Patch #1

Prepared By: Itai Peperovich	**Date:** 01/10/01

Description

This patch includes new DDB load files (ver. 27 04) for the VLSI configuration (**ONLY**).

This patch solves the communication error-**operation 'put' of DDB board failed (OpCode80).**

Note: This patch is only for ver 3.20.01

Prerequisites

1. NUC board comp level N and higher.
2. DDB-1N board.

Installation Procedure

Note: Before installation make sure that all the applications are closed.

1. Insert a blank diskette into the floppy drive. Save the attached file named "**Lotem update.exe**".




Lotem update.exe

2. Using the GUI, open the front and right side doors.
3. Insert the diskette with the saved file into the machine floppy drive.
4. Using the explorer, go to drive A and double-click on the file.
5. The **Lotem update – installation wizard** window will be displayed, and the new Hex file will be loaded.
6. After loading the new Hex file, a **Welcome - Lotem update install** window will be displayed. Click **Next** when the loading ended.

Note: The patch will change the Lotem800V\VERSION\Service Pack" to 1.

7. Remove the floppy diskette from drive A and close all the doors.
8. Start up the application. Make sure the machine is in **Ready** mode.
9. From the GUI, go to **Hardware/Boards** and double-click on the **DDB Card**. It will take a few minutes until the new Hex file will be loaded.
10. Make sure that after finishing the upload, the machine is in **Ready** mode.
11. Click the **Version Info** box in the DDB dialog (see picture no. 1). Make sure that the existing file is the same as shown in picture number 2.

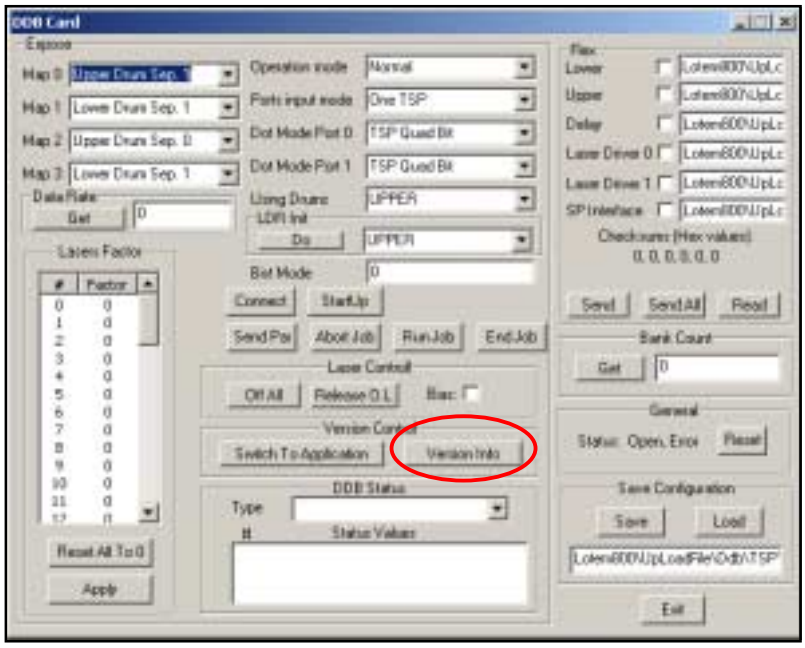

Picture no. 1



Picture no. 2

12. Close the DDB Card dialog.
13. Perform laser calibration to check the DDB board.

Test procedure

1. Load a plate.
2. Re-expose the file which caused communication problems. Make sure the expose ends with no error messages.

Document Tracking Information

Product Name:	**LOTEM 800**
Document Name:	**Ver 3.20.01 Patch #1**

Word Doc Name	Author	Create Date
Lotem 800 Ver 3.20.01 patch #1_edit.doc	Itai Peperovich	10-Sep-01

URL	File Name (HTML)

Editor	Edit Date
Danielle Blander	**23-09-01**
Posted by	**Post Date**