
$LCABLE_TRAINING/OREN/ML00944A/motor_wiring_cbl/schematic/sheet1 last update : 30/07/06

L=0.12M

Note:
1. Cover the ferrite with Shrink p/n 450A05001 30mm and Shrink.
2. Cover the legs of the motor After soldering with shrink p/n 450A02001 2X15mm And Shrink.

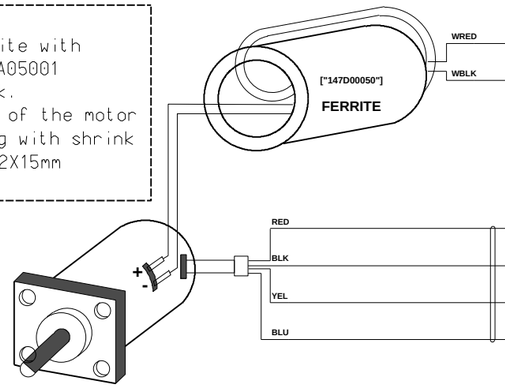

184-00025

MOTOR_P	WHT/RED	22#		1
MOTOR_N	WHT/BLK	22#		5
P5V	RED			3
GND	BLK			7
ENC_A	YEL			4
ENC_B	BLU			8
GND	CHASS	GRN	18#	2

MOTOR
180G00810
197B10320

196B10030

L=0.2M

BLOCK: _		TITLE: MOTOR_WIRING	
PROJECT MAGNUS_800		UPDATED TO 30/07/06	
creo™		NAME	DATE
	EDIT	ELI_TZADKA	21/06/06
	CHKD	ELI_TZADKA	21/06/06
	DSND	ELI_TZADKA	21/06/06
	APPD	ELI_TZADKA	21/06/06
SIZE A3	DWG: 220-00944A	REV A	SHEET 2 OF 2